




GT400 DIGISTAR FOR VALMAR 11 TON SPREADERS

13196 34TH ST. SE TOWER CITY, ND 58071
701-361-4790 • NORTHSTAR-AG.COM

Scale Setup # 125020, 20,000 #
Scale Setup # 125025, 25,000#
Calibration #24480

STEP 1:

Determining New Setup and Calibration Numbers

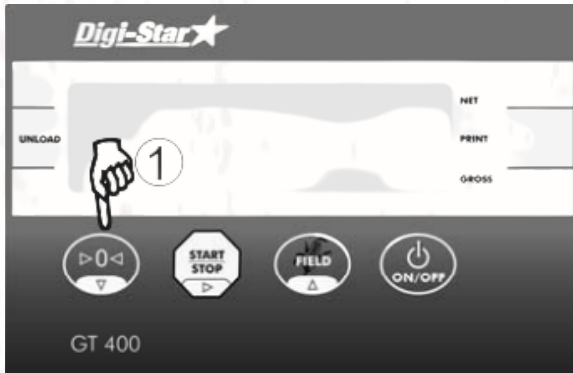


1. Press to Zero-Balance.
 2. Put KNOWN WEIGHT on scale platform and write down DISPLAY WEIGHT.
- Perform following equation to find ACCURATE CAL NUMBER.

$$\frac{\text{Known Weight}}{\text{Displayed Weight}} \times \text{Existing Calibration Number} = \text{Accurate Calibration Number}$$


The setup number does not change.

STEP 2:

Enter A New Setup And Calibration Number

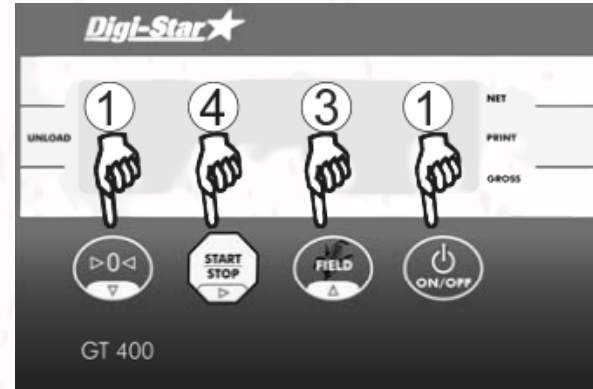

1. Press and hold and for 3 seconds to enter short form calibration.
 2. The display will flash "SETUP" and then display the 6-digit setup number with the right digit flashing.
 3. Press several times to increment digit to its proper value.
 4. Press to advance digit left.
- Repeat steps 3 and 4 for each digit as required.

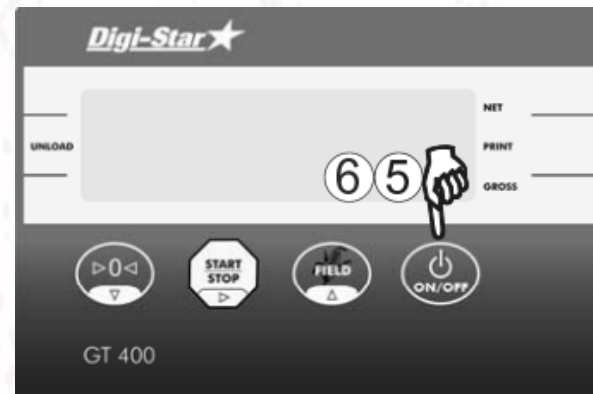

5. Press to enter new setup number and display calibration number.
- Repeat steps 3 and 4 to modify the calibration number.
6. Press to enter new calibration number and display will go back to normal.
 7. Verify the accuracy of scale.